

Menu

HISTORY FILE MAP for year 2002

REALTIME


PLAYBACK

RECALLED REALTIME

RECALLED PLAYBACK

164.01:17-01:27: 10m realtime 1024bps data lost due to long 1-way transition at DSS-63. No DR was raised.

162.05:08-05:36: 28m realtime 1024bps data lost due to problems downloading pointing predicts at DSS-15. Problem was corrected by cleaning and reseating boards in the ACS assembly. DR G101243 refers

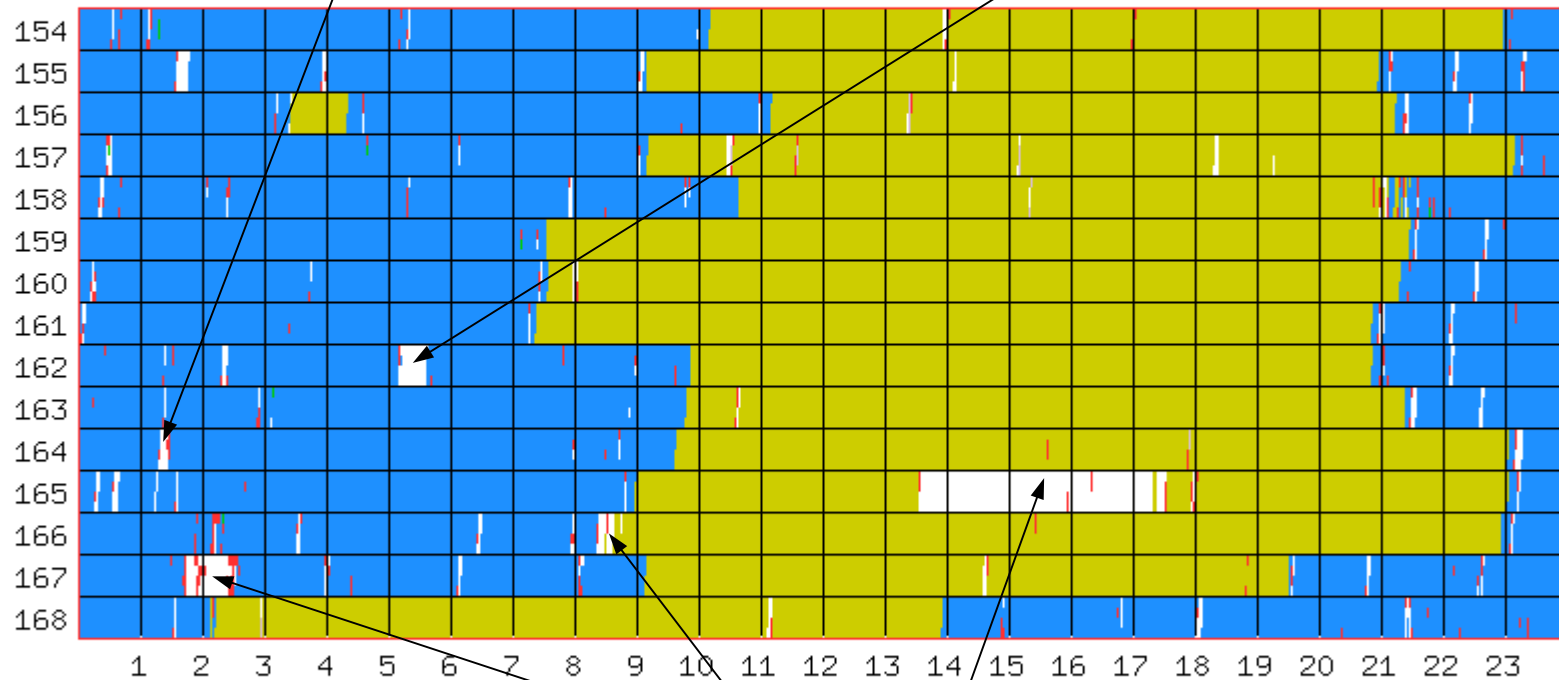

167.01:41-02:32: 51m realtime 1024bps data and 4h 0m of (165.13:32-17:18) 512bps playback data lost due to low link margins (166.08:20-08:34) and consequent loss of telemetry and receiver lock during 4K playback. DR N100472